

# CONTENT

Foreword .....	1
1. RichAuto system composition .....	4
1.1 System composition .....	4
1.2 Description of Each Component .....	5
2. Instruction to Handle controller keyboard .....	8
2.1 Introduction .....	8
2.2 Usage .....	8
2.3 Detail information for key functions .....	11
3. Wiring Instructions .....	13
3.1 RichAuto Stepping wiring instructions .....	13
3.2 Patch Board I / O Description .....	14
3.3 Hardware Connection.....	19
3.4 Commissioning of The Machine and Control System.....	26
4. Menu direction .....	27
4.1 Menu category .....	27
4.2 Menu detail .....	27
5. Machine operation.....	39
5.1 Return home .....	39
5.2 Import processing files .....	39
5.3 Manual processing operation .....	40
5.4 Automatic machining operation .....	49
5.5 Processing operations .....	52
5.6 Advanced Processing .....	49
PS 1. Handle operating system upgrades .....	62

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## ● Foreword

### System Introduction:

**RichAuto** is CNC motion control system independently developed by Beijing ruizhi tianhong and it can be widely applied to machinery, advertisement, woodworking, mold engraving machine, laser, flame, plasma cutting machine, and so on in the machine control field.

**RichAuto** make DSP as the core control system, High-speed processing operation is the microcontroller, PLC systems can't match; Use embedded structure, High degree of integration, Strong stability, easy to installation and operation; U disk support, Removable storage card reader, With USB Interface, High speed transfer, Plug and play the full realization of all work offline.

### Characteristics:

1. System deploy standard X, Y, Z axis motion control method ,Support the rotation axis (C axis) control, Enables to switch the processing of surface and processing of rotation ; up extended to X, Y, Z, C four-axis motion control, Implementation four axis interlocking Control.
2. Multi I / O Point Control, there is eight input and output signals in every basic I / O signal node, Expansion I / O nodes can be expanded to 32 input and output signals.
3. Support the standard G code, PLT format instructions; support domestic and international mainstream CAM software, such as: Type3, Art cam, UG, Pro / E, Master CAM, Cimatron, Wentai etc.
4. Provide with power-down protection. Instantaneous power processing system to

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

automatically save the current processing of information (file name, current line number processing, processing speed, spindle threshold), when power again machine moves back, the system automatically prompts the user to restore the processing before power down, the processing operations become more humanity.

5. Support breakpoint memory, file selection, processing. Save 8 different breakpoint processing information.
6. Multi-coordinate memory function. Provide nine working coordinate system, the user can switch among the 9 coordinate, each coordinate system can save a process origin information.
7. Support online adjust spindle operating frequency. The spindle frequency from 0 to maximum frequency is divided into 8 thresholds; 1 - 8 threshold can be processed directly adjust up and down without suspend processing.
8. Support adjust speed ratio online. Users can adjust the speed ratio, to adjust the processing speed and empty running speed, speed ratio values from 0.1-1, Ascending or descending per 0.1 numerical.
9. Simply manual operate mode. In manual mode, the system provides three kinds of sports concluding continuous, step (crawl), distance, manual operation became more simple and convenient.
10. Identifies M code, F code and other development commands, can open a special code based on user needs.
11. Built-in 512 M memory.
12. Unique handheld form factor with one hand to hold. Own liquid crystal display and 16 key keyboard , operate intuitive and flexible, no longer dependent on the computer, the full realization of full offline operation

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

13. Comes with USB communications port, file transfer efficiency can be directly read U disk, card reader file, Plug and Play.
14. Self-test function, the system comes with I / O port signal detection capabilities, ease of remote maintenance.
15. Processing with high-speed and smooth, support high subdivide, make sure processing with high accuracy and high speed.
16. Unique in Chinese-English to show double-interface, can be realized in switching Chinese and English show online.
17. Multi-language display. Support for Simplified Chinese, Traditional Chinese, English, Russian, French and other languages, can be customized according to user needs.
18. System can support automatic dynamic upgrades, convenient to remote operation, remote maintenance.

## Notice:

1. Forbid in strong interference and strong magnetic field environment.
2. Do not plug signal transmission cable which connect hand-held controller to the machine.
3. When processing U disk files, do not pull out the U disk, to prevent interruption of data transmission.
4. Strictly forbidden metal, dust and other conductive materials into the hand-held controller.
5. Ground wire should be connected machine housing to ensure safety and to prevent bring in interference .
6. Unauthorized removal prohibited, no user repairable parts inside.
7. If do not use for a long time, please power-down, and properly maintained.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

- 8. Note water, dust and fire when using.

# 1. RichAuto system composition


## 1.1 System composition

**RichAuto** control system contains the following parts: A hand-held motion controller ,a line adapter board, a fifty pin data transmission cable, an USB communication cable.

### RichAuto accessories schematic diagram



**Hand- held motion controller**

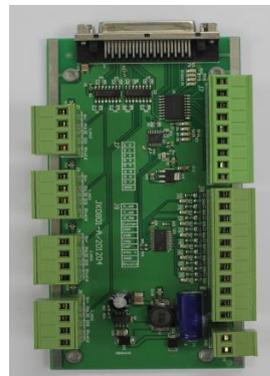

**adapter board**

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)



**50 pin data transmission cable**



**USB communication cable**

Figure 1-1

## 1.2 Description of Each Component

1. Handle: the core of the lower computer, it contains six modules.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)



**(1).**LCD: Resolution of 128 \* 64 LCD display, To display the machine motion, and the information, such as the system settings and other information.

**(2).**KEYBOARD: It contains 16 keys to input the system parameter information and operate the machine.

**(3).** U Disk Interface: external memory access ports to U disk and the memory card. The file format can be identified by the external memory is FAT16/32.

**(4).**50-pin Data Cable Jack: through 50 pin data transmission cable and line adapter can achieve the connection between system and the machine. The system sent the movement to machine motion actuator.

**(5).**USB Communication Port: USB data line access port. It is used to connect

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

the host computer with r computer.

**(6). Company LOGO.**

**2. Interface Board:** The operation between the low computer and machine is completed by the link of the interface boards. It contains 6 parts.

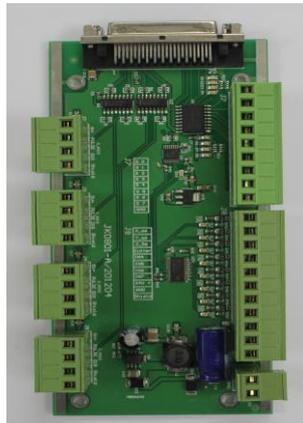

**Interface board**

**(1).** 50-pin data cable jack: The connection between the system and the machine can be completed through 50 pin data transmission cable and line adapter and then the system can sent the movement signal to machine motion actuator.

**(2).** Output control terminal: It can control start and stop of the spindle and gear change. Different connection ways refer to different control. You can check the details in the menu notes, "spindle set the option" Help.

**(3).** Input control terminal: The input terminal for the machine origin detection

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

switch signal.

**(4).**Power supply terminal: the input terminal for system switching Power Supply. (DC24V 3A)

**(5).**Motor drive control terminal: the output terminal for drive control line.

### 3. 50 pin data transmission cable



### 4. USB communication cable

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111


Web site: [www.richnc.com.cn](http://www.richnc.com.cn)




## 2 Instruction to Handle controller keyboard

### 2.1 Introduction :

**RichAuto** system handle controller defines 16 operation keys according to the system functional requirements. Each key has one or more functions under different work status:

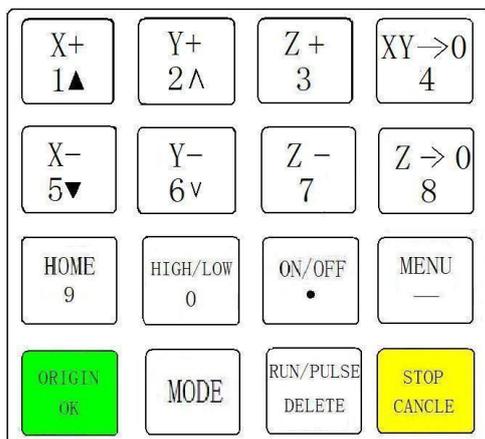

16-key layout

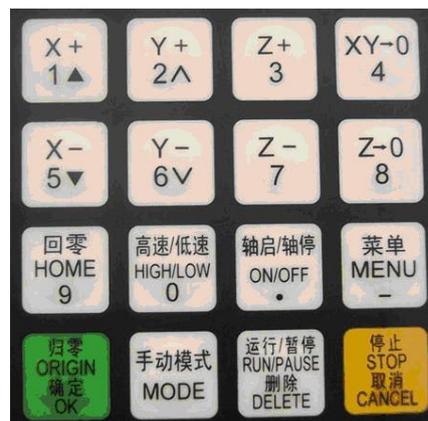

Chinese Button really making plans

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## 2.2 Usage:

 
 
 
**RichAuto** control system divided the key's operation into one-touch button operation, and the combined-key operation.

One Touch: Press one button on handheld motion controller.

Combined-key operation: Press two buttons at the same time to achieve the operation;

The operation step: press one main function key and meanwhile press a second accessibility key, and then release the two keys at the same time to realize the combined-key operation.

**PS:** Commonly used combined-key list:








	Combined-key	Function
<b>1</b>	 + "0—9" Number keys	to switch the coordinate system (0 for the mechanical coordinate system , 1 - 9 for the work coordinate system)
<b>2</b>	 + 	Start Z-axis automatic tool setting

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

       Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

<b>3</b>	 + <b>"1-6"</b> Number keys	to start the break processing (support number 1 - 6)
<b>4</b>	 + 	to start the advanced processing modes
<b>5</b>	 +  / 	To switch gear shaft
<b>6</b>	 + 	Repeat last time processing
<b>7</b>	 + 	Help information
<b>8</b>	 + 	System update
<b>9</b>	 + 	Manual switching spindle

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

 Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

10	 + 	Calculate spindle offset
----	---	--------------------------

### 2.3 Detail information for key functions:

key	Function
	Positive movement of X axis, Menu upward , figure 1 inputting
	Positive movement of Y axis, accelerate process speed, figure 2 inputting, different property selecting in Menu
	Positive movement of Z axis, figure 3 inputting, rise spindle speed in process
	Working origin of X axis and Y axis setting, figure 4 inputting

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

 
	<p>Negative movement of X axis; Menu downward, figure 5 inputting</p>
	<p>Negative movement of Y axis; slowdown process speed; figure 6 inputting different property selecting in Menu</p>
	<p>Negative movement of Z axis, figure 7 inputting, spindle speed adjusting in process</p>
	<p>Z axis origin setting ; figure 8 inputting</p>
	<p>Axes home to machine tool origin, figure 9 inputting</p>
	<p>Manual moving mode, high speed or low speed selection, figure 0 inputting, change work coordinate &amp; mechanical coordinate when auto work</p>
	<p>Spindle startup/stop, decimal point inputting</p>

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

	<p>Menu setting entering, negative symbol inputting, multi process state checking</p>
	<p>All axes go working origin: confirm of motions /inputting/operating</p>
	<p>Manual move, continue, step and distance modes selection</p>
	<p>Cut process running/pause/inputted words delete</p>
	<p>High/low speed parameter adjust, Cut process stop/selections, inputting and operating cancel</p>

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China


Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

### 3. Wiring Instructions

#### 3.1 RichAuto Stepping wiring instructions

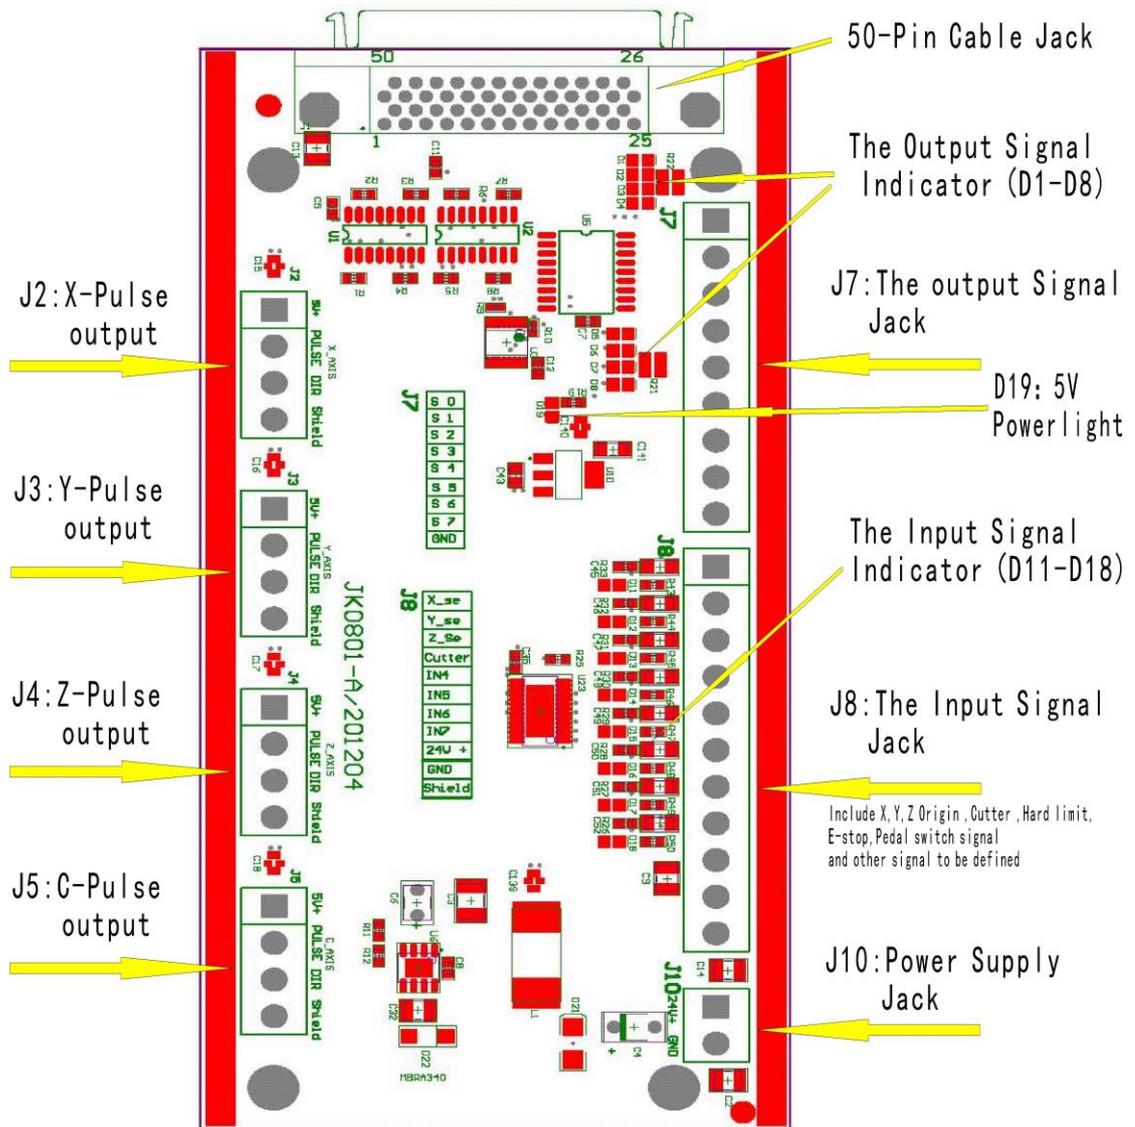


Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

### 3.2 Patch Board I / O Description

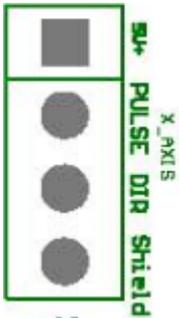
Port label	Port definition	Pin Definition	Pin functions and parameters	Notes
<b>J10</b> 	System Main power	System main power supply side	System main power supply terminal , interface board give DC 5V for system. When F3 shorted can provide voltage to XYZ	Power area: DC10V~DC24V/3A
<b>J 2</b> 	X-axis pulse output port	Were positive signal output port	X-axis drive common anode power supply terminal 5V output	Do not impose voltage on this pin
		Pulse signal output port	X-axis drive pulse signal output port, the output voltage $\geq 3V$ drive current $\leq 8mA$	
		direction signal output port	X-axis direction of the drive signal output port output voltage $\geq 3V$ drive current $\leq 8mA$	
		Shield connection port	X-axis drive signal output voltage line terminal shield	Do not use this port for the grounding port
<b>J 3</b>	Y-axis pulse output port	Were positive signal output port	Y-axis drive common anode power supply terminal 5V output	Do not impose voltage on this pin
		Pulse signal output port	Y-axis drive pulse signal output port, the output voltage $\geq 3V$ drive current $\leq 8mA$	
		direction signal output port	Y-axis direction of the drive signal output port output voltage $\geq 3V$ drive current $\leq 8mA$	

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)


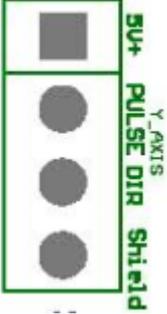
		<b>Shield connection port</b>	<b>Y-axis drive signal output voltage line terminal shield</b>	<b>Do not use this port for the grounding port</b>
<b>Port label</b>	<b>Port definition</b>	<b>Pin Definition</b>	<b>Pin functions and parameters</b>	<b>Notes</b>
<b>J 4</b>  	<b>Z-axis pulse output port</b>	<b>Were positive signal output port</b>	<b>Z-axis drive common anode power supply terminal 5V output</b>	<b>Do not impose voltage on this pin</b>
<b>Pulse signal output port</b>		<b>Z-axis drive pulse signal output port, the output voltage <math>\geq 3V</math> drive current <math>\leq 8mA</math></b>		
<b>direction signal output port</b>		<b>Z-axis direction of the drive signal output port output voltage <math>\geq 3V</math> drive current <math>\leq 8mA</math></b>		
<b>Shield connection port</b>		<b>Z-axis drive signal output voltage line terminal shield</b>	<b>Do not use this port for the grounding port</b>	
<b>J 5</b>	<b>C-axis pulse</b>	<b>Were positive signal output port</b>	<b>C-axis drive common anode power supply terminal 5V output</b>	<b>Do not impose voltage on this pin</b>
		<b>Pulse signal output port</b>	<b>C-axis drive pulse signal output port, the output voltage <math>\geq 3V</math> drive current <math>\leq</math></b>	

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

 Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

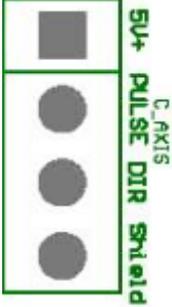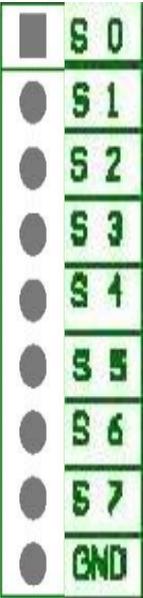	output port		8mA	
		direction signal output port	C-axis direction of the drive signal output port output voltage $\geq 3V$ drive current $\leq 8mA$	
		Shield connection port	C-axis drive signal output voltage line terminal shield	Do not use this port for the grounding port
Port label	Port definition	Pin Definition	Pin functions and parameters	Notes
<b>J 7</b> 	Output Control terminal	Y1: Spinder ON/OFF	Connect to FWD of inverter	Output Low level signal
		Y2: speed 1	Connect to inverter to control speed	Output Low level signal
		Y3: speed 2	Connect to inverter to control speed	Output Low level signal
		Y4: speed 3	Connect to inverter to control speed	Output Low level signal
		Y5: Spindle Cylinder signal	Control cylinder of spindle 1 up and down r	Output Low level signal
		Y6: Spindle Cylinder signal	Control cylinder of spindle 2 up and down	Output Low level signal

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

 Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

		<b>Y7: Spindle Cylinder signal</b>	<b>Control cylinder of spindle 3 up and down I</b>	<b>Output Low level signal</b>
		<b>Y8: Spindle Cylinder signal</b>	<b>Control cylinder of spindle 4 up and down</b>	<b>Output Low level signal</b>
		<b>GND:output GND</b>		<b>GND connect to this terminal in control inverter speed mode</b>

**PS:** All the pin terminals are for the parties sort the mouth as the first one, the bit serial extended direction of the arrow.


<b>Port label</b>	<b>Port definition</b>	<b>Pin Definition</b>	<b>Pin functions and parameters</b>	<b>Notes</b>
<b>J 8</b>	<b>input Control terminal</b>	<b>X1:X_se: X origin sensor Signal Input</b>	<b>X origin sensor signal input terminal</b>	<b>Input low level signals</b>
		<b>X2:Y_se: Y origin sensor Signal Input</b>	<b>Y origin sensor signal input terminal</b>	<b>Input low level signals</b>
		<b>X3:Z_se: Z origin sensor Signal Input</b>	<b>Z origin sensor signal input terminal</b>	<b>Input low level signals</b>
		<b>X4:CutterTool-setting sensor signal input</b>	<b>Tool-setting sensor signal input terminal</b>	<b>Input low level signals</b>
		<b>X5 : Driver alarm signal input</b>	<b>Driver alarm signal input terminal</b>	<b>Input low level signals</b>

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

 Web site: [www.richnc.com.cn](http://www.richnc.com.cn)


	<b>X6:Hard limit signal input</b>		<b>Hard Limit signal input terminal</b>	<b>Input low level signals</b>
	<b>X7 : E-stop signal input</b>		<b>E-stop signal input terminal</b>	<b>Input low level signals</b>
	<b>X8 : Pedal switch signal input</b>		<b>Pedal switch signal input terminal</b>	<b>Input low level signals</b>
	<b>24V+: Sensor power input</b>		<b>X、Y、Z sensor isolate circuit power supply positive input terminal</b>	<b>Sensor isolate circuit supply voltage range DC10V~DC24V</b>
	<b>GND: GDN input</b>		<b>X、Y、Z sensor isolate circuit power supply negative input terminal</b>	
	<b>Shield: Shield input</b>		<b>Sensor signal cable shield input terminal</b>	<b>Do not use this port as a negative use of the sensor isolation circuit power</b>
Port label	Port definition	Pin Definition	Pin functions and parameters	Notes
	<b>D19</b>	<b>Power LED</b>	<b>Interface board 5V indicator indicate the interface and internal power supply status moderators</b>	<b>Lights after power</b>
	<b>D11</b>	<b>Status indicator</b>	<b>X origin status indicator</b>	<b>Light after power. Input low level signal, the lights will be put out. Release the signal,the</b>
	<b>D12</b>	<b>Status indicator</b>	<b>Y origin status indicator</b>	
	<b>D13</b>	<b>Status indicator</b>	<b>Z origin status indicator</b>	
	<b>D14</b>	<b>Status indicator</b>	<b>Tool-setting Status indicator</b>	

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

  Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

	<b>D15</b>	<b>Status indicator</b>	<b>Driver alarm status indicator</b>	<b>lights will be bright again</b>
	<b>D16</b>	<b>Status indicator</b>	<b>Hard Limit status indicator</b>	
	<b>D17</b>	<b>Status indicator</b>	<b>E-stop status indicator</b>	
	<b>D18</b>	<b>Status indicator</b>	<b>Pedal switch status indicator</b>	
	<b>D1</b>	<b>Status indicator</b>	<b>output terminal Y1 status indicator</b>	<b>Output low level signal when the system works</b>
	<b>D2</b>	<b>Status indicator</b>	<b>output terminal Y2 status indicator</b>	
	<b>D3</b>	<b>Status indicator</b>	<b>output terminal Y3 status indicator</b>	
	<b>D4</b>	<b>Status indicator</b>	<b>output terminal Y4 status indicator</b>	
	<b>D5</b>	<b>Status indicator</b>	<b>output terminal Y5status indicator</b>	
	<b>D6</b>	<b>Status indicator</b>	<b>output terminal Y6status indicator</b>	
	<b>D7</b>	<b>Status indicator</b>	<b>output terminal Y7 status indicator</b>	
	<b>D8</b>	<b>Status indicator</b>	<b>output terminal Y8 status indicator</b>	

**PS:** All the pin terminals are for the parties sort the mouth as the first one, the bit serial extended direction of the arrow.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

### 3.3 Hardware Connection

Installation Requirements : Switching Power ( 24V 3A ) should add a filter to prevent interference with the electric field. If origin detecting switch are different power supply type, the special testing switching power is needed. ( 24V origin detecting switch is the best choice )

RichAuto control system realizes its control through the connection between the interface board and CNC machine. Interface board terminal can be divided into input terminal and output terminal :

Input terminal includes :

J8 ( input control terminals )

J10 ( main power terminals ) .

Output terminal includes :

J2 ( X axis pulse signal output terminal )

J3 ( Y axis pulse signal output terminal )

J4 ( Z axis pulse signal output terminal )

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111


Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

J5 ( C axis pulse signal output terminal )

J7 ( output control terminal )

### Input terminal

1 sensor input ①Mechanical(Y,Z are the same as X)

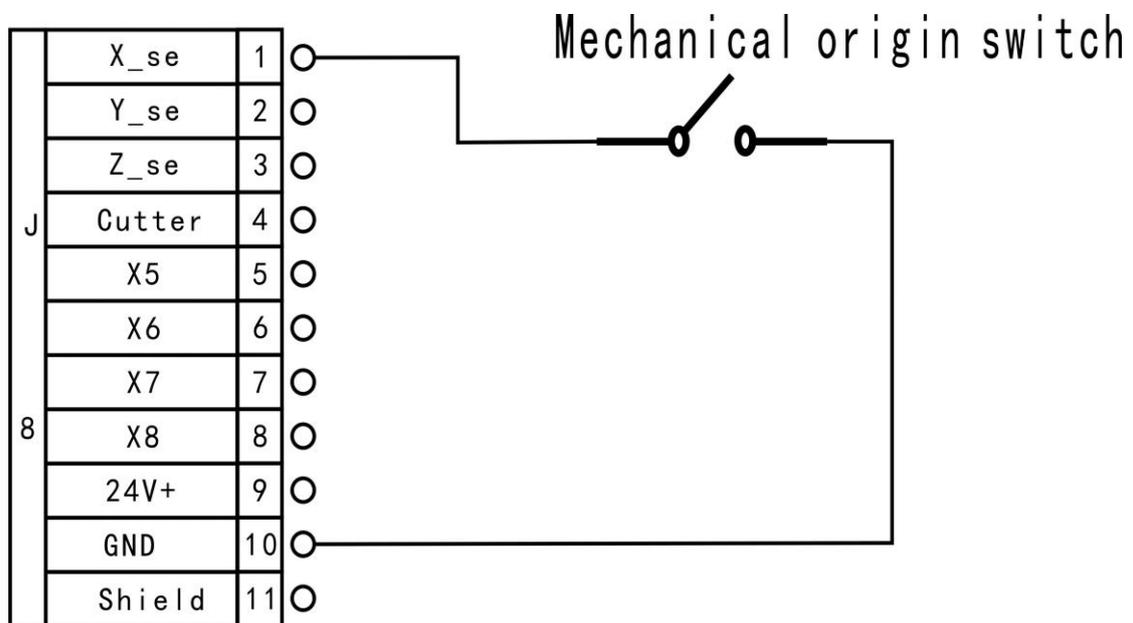


② NPN(NO): Y and Z are the same as X

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

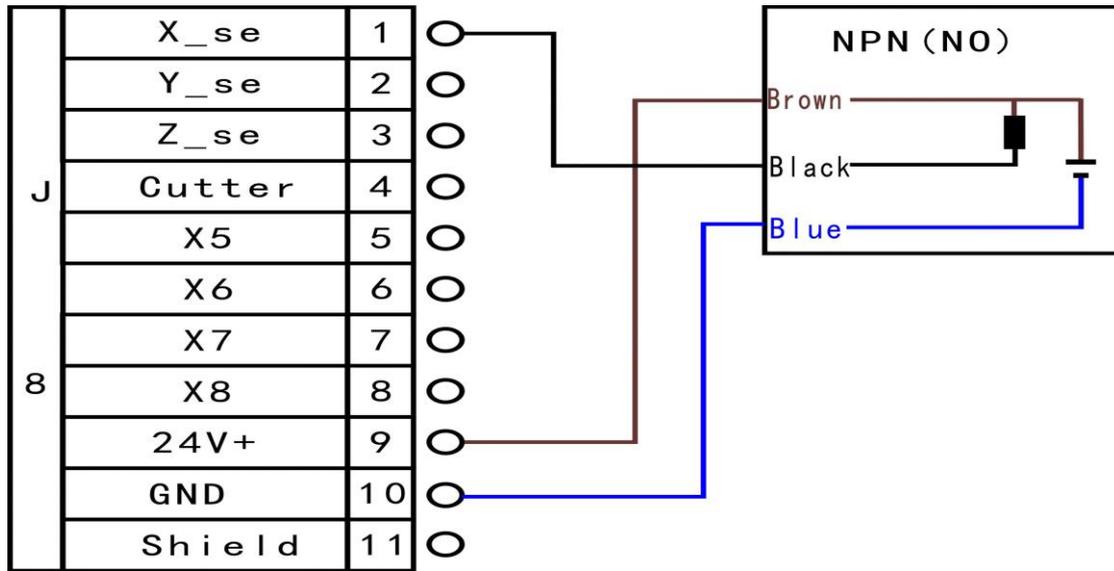


③ PNP(NO) : X and Z are the same as Y

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China


Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

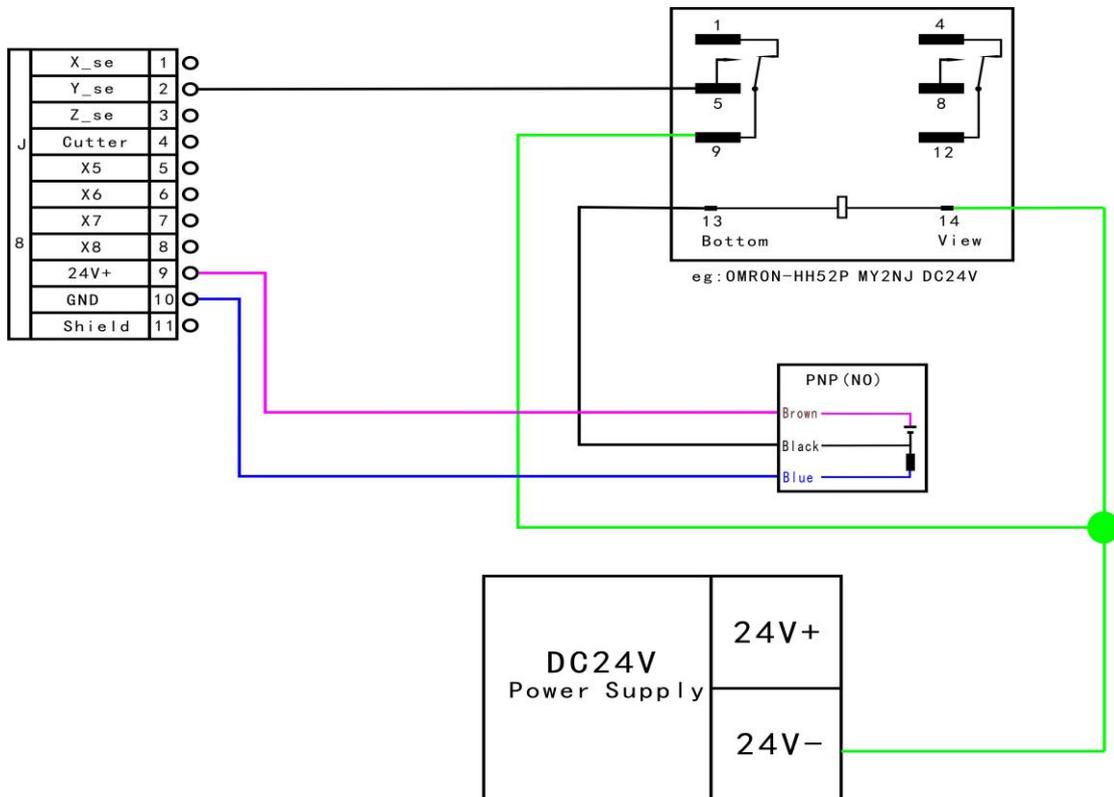

## 2 Tool-setting input: Tool-setting detecting wiring:

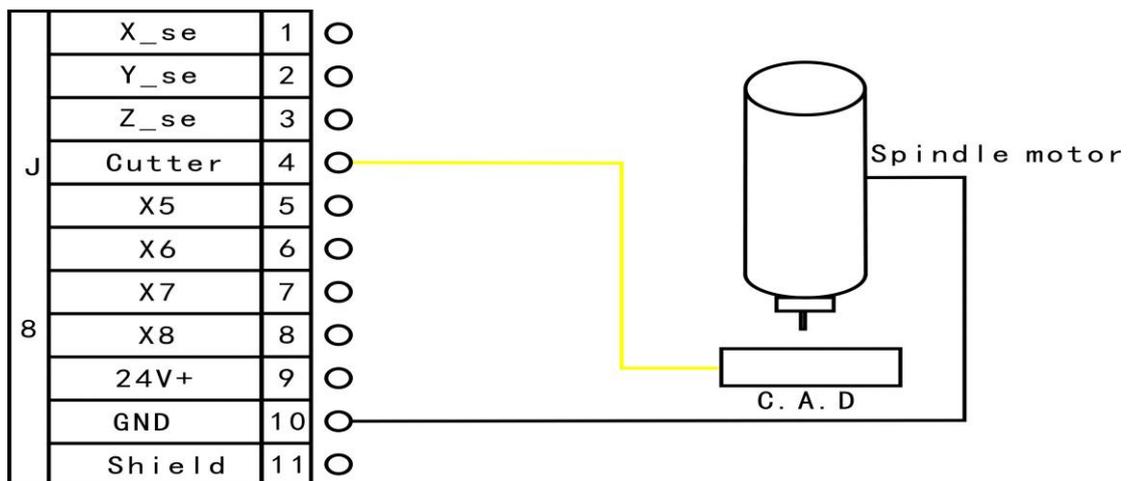


Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

### 3 X5-X8 Driver alarm, Hard limit, E-stop, Pedal Switch signal

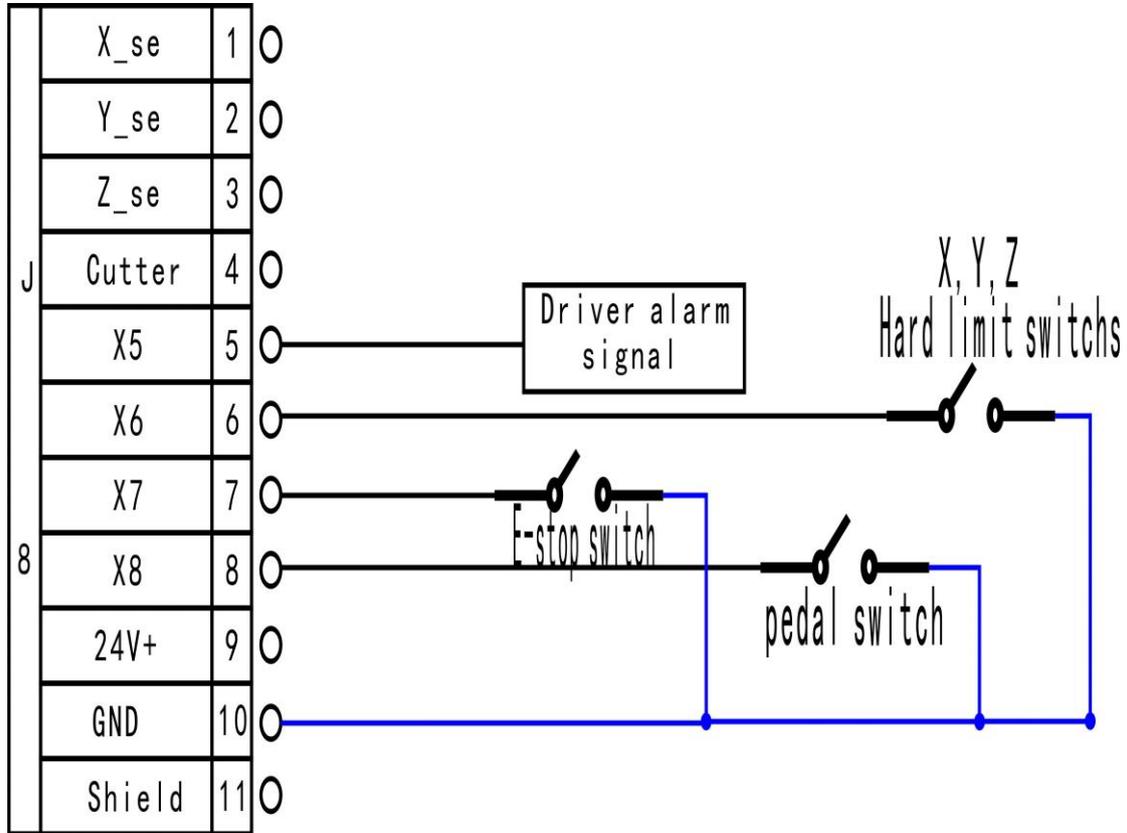

### J10 Main power wiring:

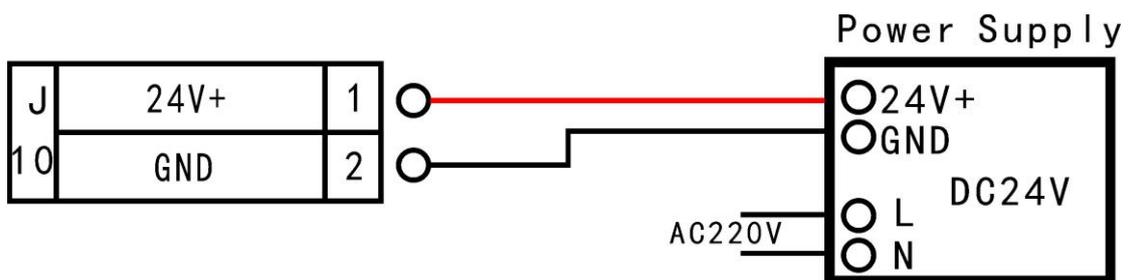

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China


Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## Output terminal

J2 X pulse signal wiring ( Y、 Z the same as X )

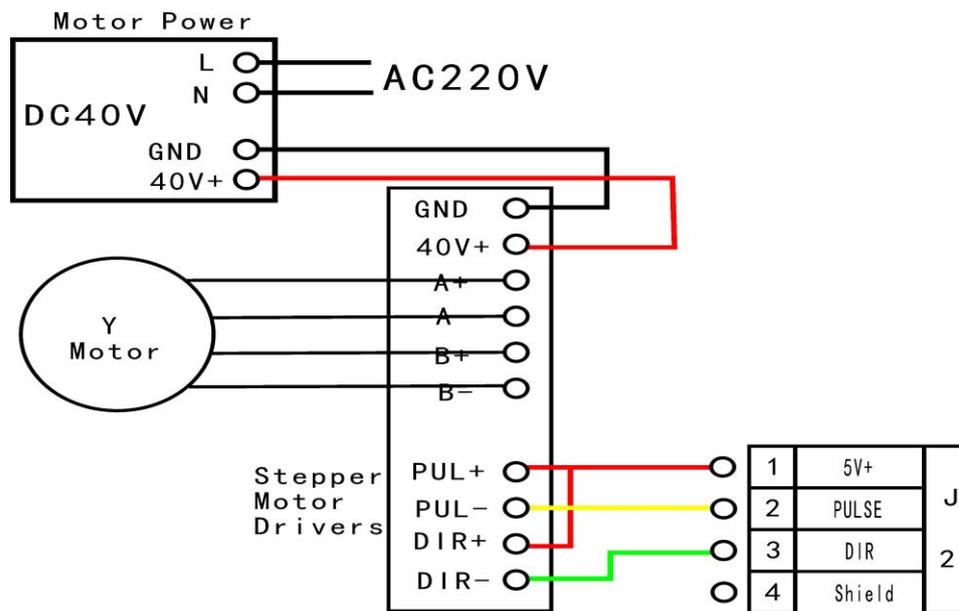

J7 Spindle inverter


2 status : spindle start/stop

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

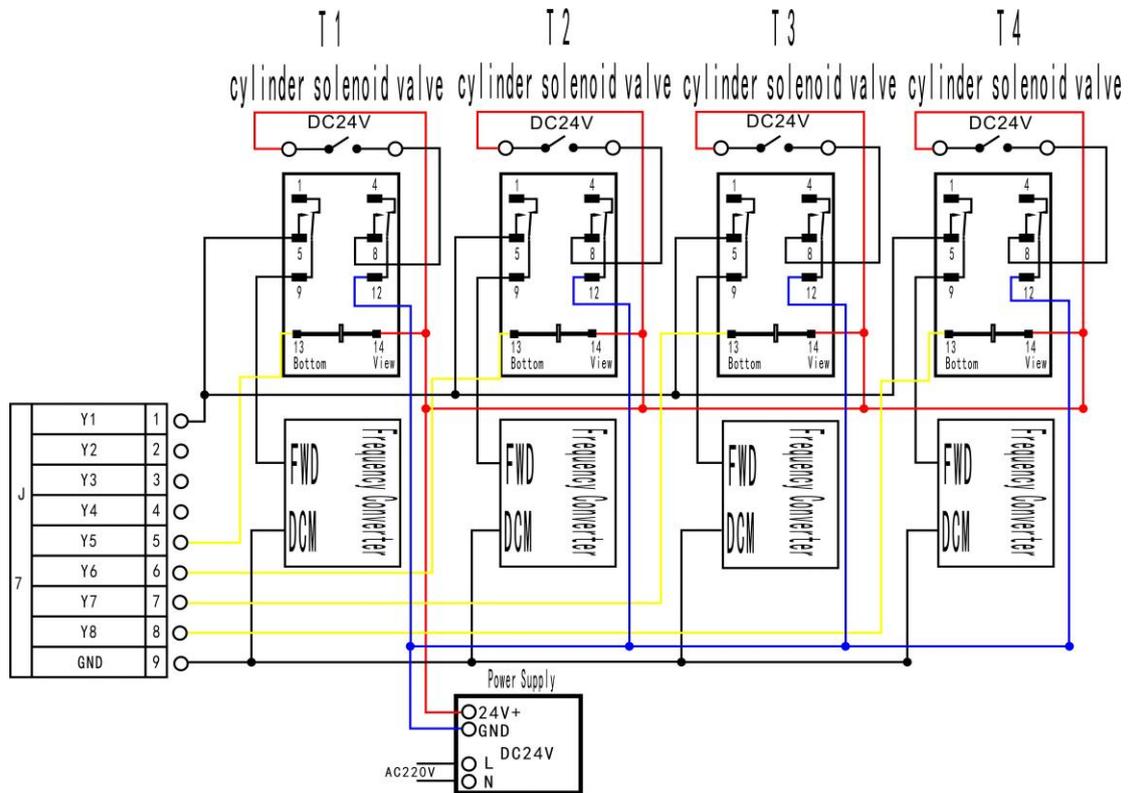

The corresponding spindle setting is:

1 Shift	↓
2 Shift	↑

8 status : spindle start---S1—speed 1 , S2—speed 2 , Sn—speed n , when spindle stop , the screen displays Fn—the speed before spindle stop.


Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

3 lines,8 status

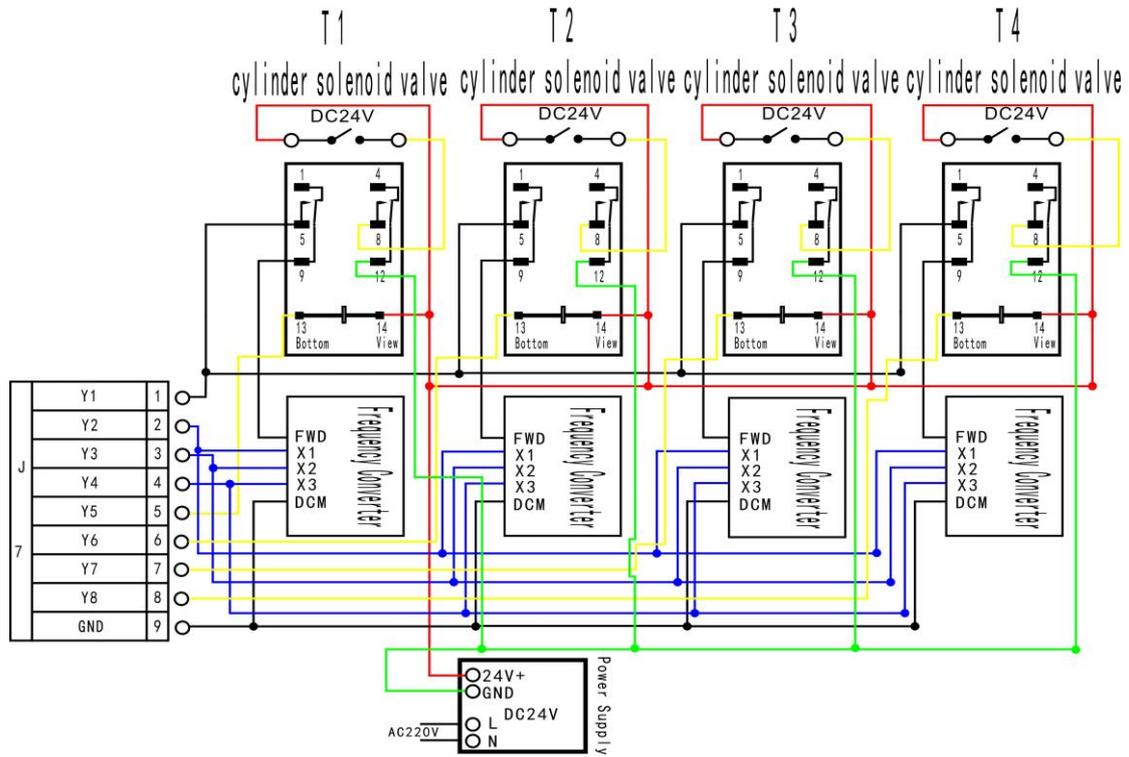

The corresponding spindle setting is:

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

1 Shift	↓	↓	↓
2 shift	↑	↓	↓
3 shift	↓	↑	↓
4 shift	↑	↑	↓
5 shift	↓	↓	↑
6 shift	↑	↓	↑
7 shift	↓	↑	↑
8 shift	↑	↑	↑

You can completely connect the machine with the control system when the above setting is over.

Output Y5-Alarm LED and Y6-WORK LED:

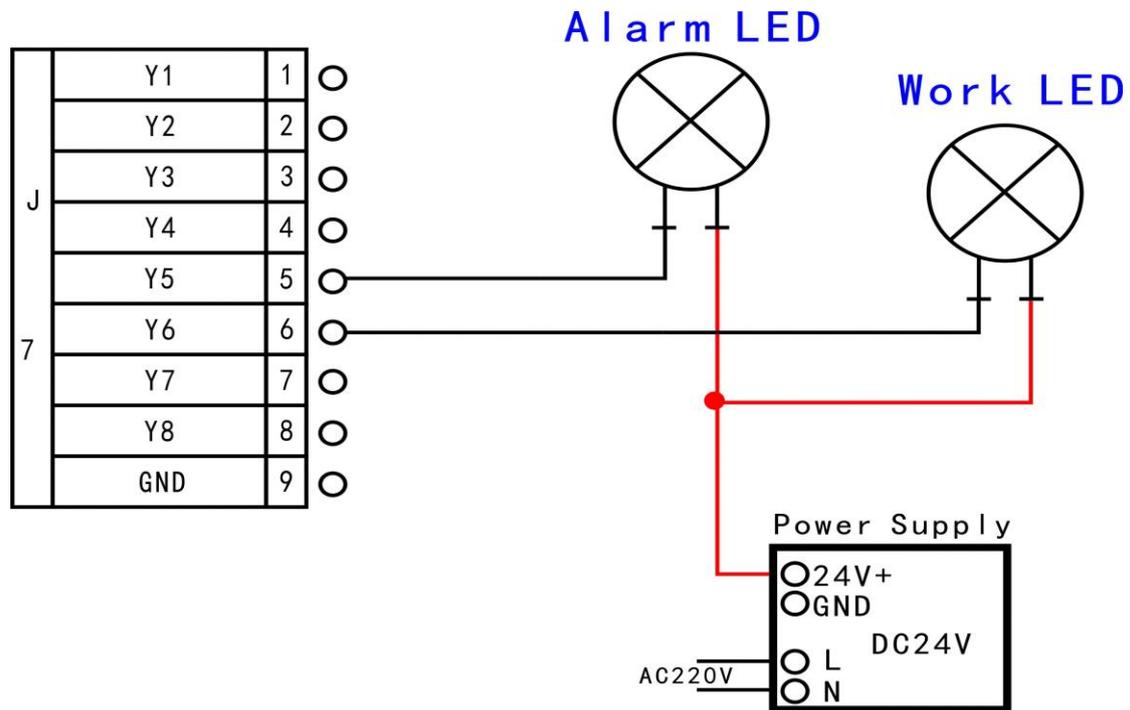

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## 3.4 Commissioning of The Machine and Control System

- 1 ) After turn on the power, you can manually run each axis movement and decide the direction. If the direction of movement and definition direction are opposite, you can set to change the motor phase sequence.
- 2 ) According to the original location of the machine coordinates, you can enter into menu-machine setting-home setting- home direction to reset it.
- 3 ) Double-press "menu"-manual voltage setup ( the upper arrows stand for input voltage ) to check whether the home switch is working.

The machine is in good connection if all the above setting is ok.

## 4. Menu direction

### 4.1 Menu category

According to menu function,RICHAUTO system menu can be divided into: **machine setup**、**auto pro setup**、**system setup**、**operate file**、**version view** , every main menu has corresponding submenus.

### 4.2 Menu detail


#### 1. Machine setup:

Machine parameter setup is to set machine hardware. This parameter is set by

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

machine producer according to device type. If machine hardware parameter is not change this parameter should not change. If machine user need to change, please dell to machine producer.

### Machine setup chart

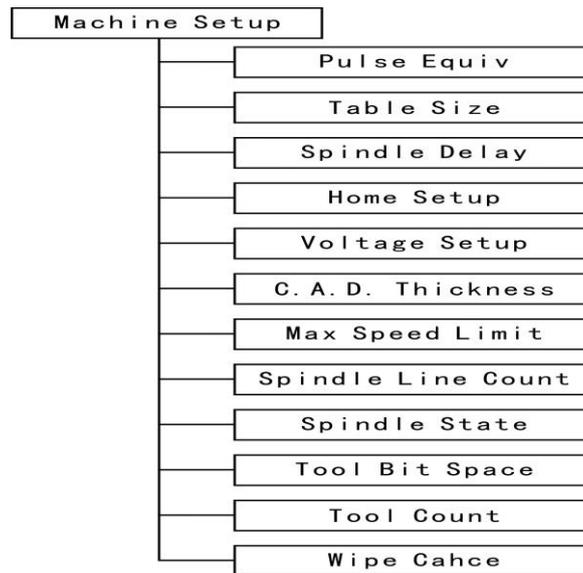

#### (1).pulse equiv:

Control system need to send pulse number when machine move 1 mm, Unit: pulse/mm; Formula = (pulse/r) / (distance/r) r (motor)

Distance/r formula:

Screw drive machine = screw pitch \* mechanical transmission ratio

Rack drive machine = rack module \* gear teeth number\*II \* mechanical transmission ratio

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

setting:

choose "pulse equiv", Cursor in the X-axis pulse equivalent, click "", "" move cursor to be modified option, click "", press the number keys to enter values, press "" to save, cursor auto move to next line, in turn modify the Y, Z axis equivalent value, press "", save all value, back to "pulse equiv".

## (2). Table Size

**RichAuto** system make the table size as the soft limit values, in order to prevent machine move over travel, machine size must be less than or equal to the value of the actual motion displacement machine.

setting:

Into "table size", click "" or "" to move cursor to be modified, press "", input modified number, click "" to save, cursor auto move to next line, in turn change **Y**, **Z** axis values, click "" to save all

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

values, back to "table size".

**(3). Spindle Delay:**

Set spindle starting time, unit : **ms**: This is also set how long system start spindle after read processing file.

**(4). Home setup:**

Home speed : set every axis move speed when machine home, system default speed is X:Y: **3000** MM/Minute, Z: **1800** MM/Minute.

- Home sequence:
- ① Z, X and Y                      ② Z,X,Y
  - ③ Z,Y,X                              ④ Z only
  - ⑤ X and Y, Z                      ⑥ X,Y,Z
  - ⑦ Y,X,Z                              ⑧ XY home
  - ⑨ X, Y home                      ⑩ Y,X home                      ⑪ None home

Home direction: set every axis move direction when machine home, this setting depends on the position where home switch in the machine. Such as the return to zero switch installed in the machine positive direction so that home direction should be set "**positive**". and vice versa.

set:

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Into "home dir", press " or " to move cursor to be modified, press " to change home direction, click " to save change, back to "home dir".

### (5). Voltage setup:

This used to set input and output signal terminal status, when set ↓ means normal open, the same ↑ normal closed.

Upper and under arrows

Upper Arrows stand for input voltage setup:

Set input voltage signal terminal status. Input voltage top 4(0,1,2,3) corresponding to X zero point, Y zero point, Z zero point, tool setting input signal terminal.

Under Arrows stand for input voltage setup:

Set output voltage signal terminal status. Output voltage top 4(0,1,2,3) corresponding to spindle on/off, multi-step 1, multi-step 2, multi-step 3 output voltage status.

Setting mode:

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Into "input voltage setup" and "output voltage setup", press "

"" to control cursor to be modified . press "", "" to get to upper or under arrows, and press "" to change terminal status.

**(6). C.A.D. Thickness:**

This thickness should input by actual, when above actual Z axis will cut over, when low to actual Z axis can't touch workpiece. This parameter can only take effect when user use auto tool change function.

**(7). Max Spd Limit:**

Set machine top speed, this set can only take effect when machine processing, system default max speed X,Y is "60000000", "Z+" is "1800", "Z-" is "3000".

**(8). Spindle Line Count:**

If line=3, Spindle Statues= $2^3=8$

**(9). Spindle Statue:**

When system using multi-step speed to control spindle, user should change this parameter. This parameters must corresponding to spindle output signal terminal wiring sequence. Detail setting please see "spindle setup".

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

### **(10). Tool Bit Space**

Input the distance from tool 2/3/4 to tool 1 (X,Y,Z)

### **(11). Tool Count**

Input the number of tools


### **(12). Wipe Cache**

Clear file fragmentation and error,operate it after system update.

## **2. Auto pro setup:**

This set processing parameters and process files read property.

Auto pro setup menu structure

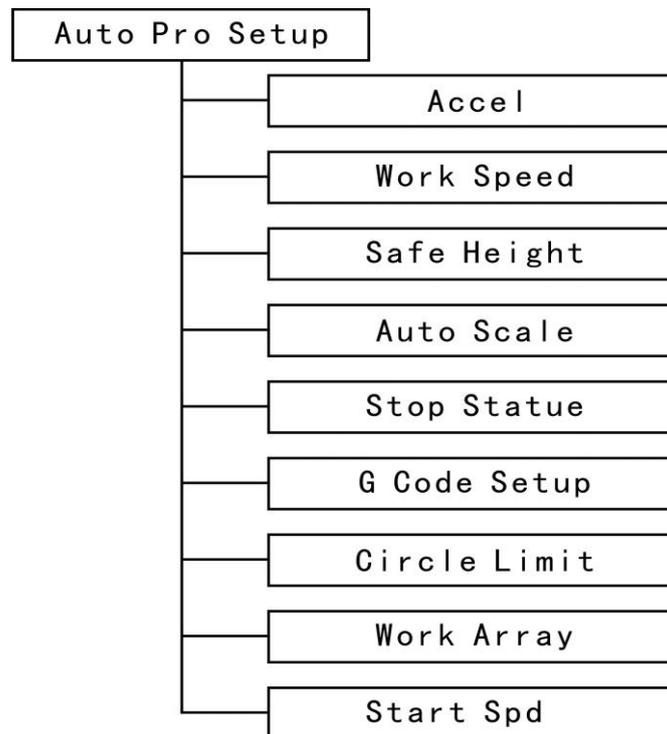

**(1) acceleration :**

This parameter can improve the ability to handling line and curve motion, unit:  
**mm/s<sup>2</sup>** System default **acceleration** is 800.

**(2) work speed: unit:mm/min**

Including work speed and fast speed. system default work spd is 6000;fast spd is 3000.

**(3) Safe height:**

This can tell us how long the file can process. Unit: s.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

**(4).Auto scale:**

Auto pro speed=Auto scale\*work speed,it does not affect the fast speed.

**(5).Fall scale:**

Include fall down scale and fall hight. system default fall down scale is 0.200,fall hight is 5.000mm. Fall down scale takes effect when the spindle falls to the fall height.

**(6).Stop Statue: Setup stop position after auto pro.**

Work stop state	
finish action pickup	
Xcoordinate	0.000
Ycoordinate	0.000
Zcoordinate	0.000

Setup stop position, press “” or “” to where to change the number, and then press “” to input the number needed, press “” to save.

Press “” to get into finish action list

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## Pickup Z

Back to work origin

Back home

Back position

None move

press “” or “” to where to change the statue, and press “” to save.

### (7).G Code Setup:

Set special code read configure in G code , such as **M**、**T**、**F**、**I**、**J**、**K** , the detail please see “**G Code Setup**”

### (8).Circle Limit:

System default circle limit is 1000.000. unit:mm/min.

### (9).Work Array:

Setup array parameter,include columncount、Rowcount、Columnspace、Rowspace、Interval (unit: ms) .

### (10).Start Speed: unit:mm/min, System default start speed is 100.000 mm/min.

Reduce the noise of the low-frequency vibration of the motor, machine run

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Smooth from Stationary state to the work speed.

### 3. System setup:

#### System setup menu structure

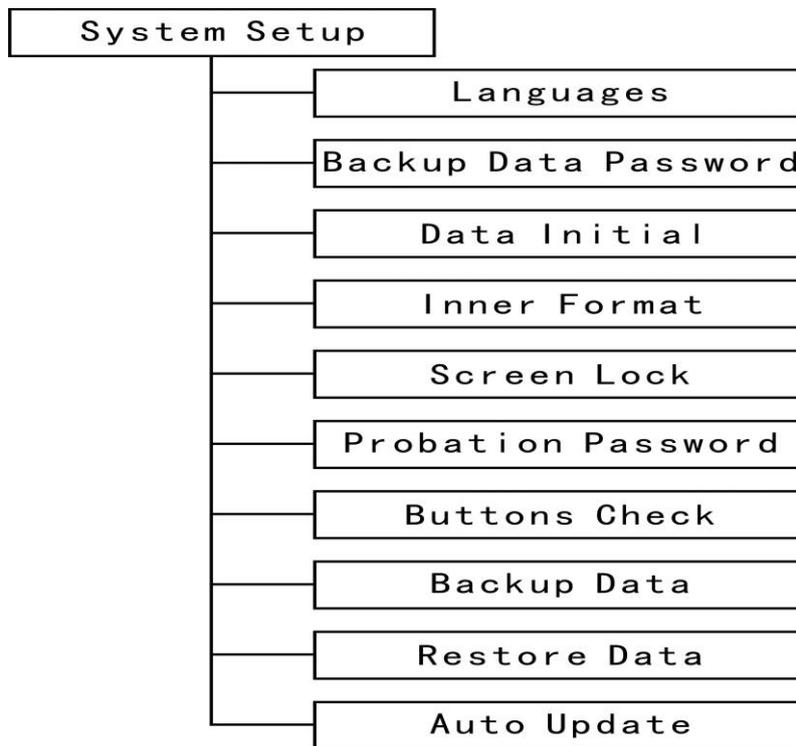

#### (1). Languages

Change system display language, choose Chinese and English.

#### (2).Backup Data Password

Prevent customers backup parameters which overwrite the original correct

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

parameters when by misoperation or when the system parameters disorder.

Cancel the password,when the display shows "input new password",do not input any number,and press button "OK".

### **(3). Data initial**

After data initial system parameters will restore factory setting.

### **(4). Inner format:**

Clean up inner files.

### **(5). Screen Lock**

The screen will lock when the time reaches to the number you setup, and then input the password to unlock the screen.

### **(6). Probation password**

You can get a 20-digit-password from the website of ourcompany.

### **(7). Buttons check**

Test the validity of the keyboard keys. Into test interface, the screen displays highlights when key take effect, no highlights when key is broken. Press "ok"+ "cancel" to quit.

### **(8). Backup Data**

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Back up menu parameters, format system can't effect this.

### (9). Restore Data


Restore backup data to system.

### (10). Auto Update

Update system online. Support the extension **\*\*\*\*\*.PKG** update file.

## 4. Operate File

### Advanced pro setup menu structures

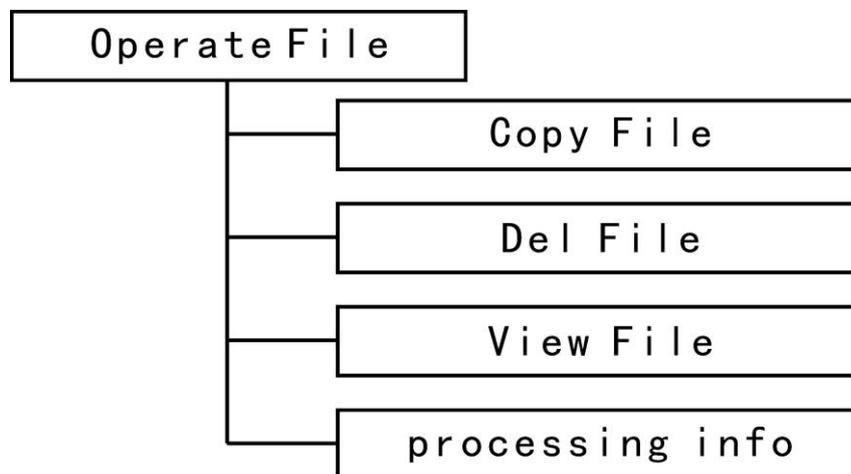

### (1) Copy File

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Copy files of U disk to Inner.

## (2) Delete File

Delete files of inner.

## (3) View File

 
View the files of U disk and inner.

## (4) Processing information

Statistical the number of files processing successfully.

**PS:Please pull out the U disk correctly after copying files from computer,if not,the controller may not recognize the U disk.**

**1. Win7(32 bit) system: after copying files,please press**  **”,and then the**

**display will show “**  **”,choose the device to be shut down.when the display show**


**”**  **”,the U disk pull out from computer successfully.**

 Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

**2. Win XP system: after copying files, please press ", and then the display will show " , choose the device to be shut down. when the display show " , the U disk pull out from computer successfully.**

## 5. Version View

Include: ① Product ID eg: A0020112    ② Soft Version eg: A1.497

③ Emergency Version eg: A1.470    ④ Update Version eg: P1.440

⑤ Soft type

⑥ Hardware type

## 5. Machine operation

### 5.1 Return home

The handle will prompt "All Axis home", "Z home only", "none axis home" after starting, choose anyone you want.

In some cases, such as after the last normal shutdown, reboot and continue last operation, users don't need to reset machine, choose "none axis home". That is because when system quit, it is auto save coordinate value.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)


## 5.2 Import processing files

Before processing, generally we should import files. There is 2 ways : U disk, inner file process.

1. Directly import processing files to U disk, we can be run.
2. Downloading files into handle by U disk.

## 5.3 Manual processing operation

Manual processing is means we control machine through keyboard. The same we can change operation speed and grid setting. After return home, system into manual status, the screen displays:

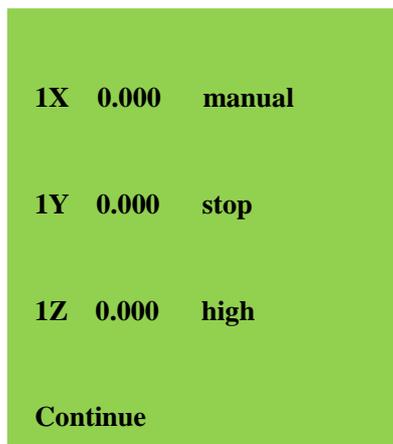

### 1. Manual operation speed adjust

There is two modes: high speed and low speed. We can change mode by

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

“” .The screen displays speed mode can decide processing speed.

Speed adjust: in manual mode, press “cannel” to set the current speed mode. If current speed is low speed, it displays as followed:



The cursor in X axis low speed mode , press “” and “” move cursor to be modified , press “” that we can change value, press “” to save, press “” to quit, if number input is wrong, press “” to delete the last number.

In order to ensure the accuracy of processing and debugging, the system introduces the concept of grid. Other systems also call it minimum feed. Its range is:

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

0.05mm-1.0mm. when user change mode to step, machine will move by grid.

High speed mode setting is the same as low speed mode.

## 2. Manual processing mode

In order to meet manual movement in different situation, this system provides 3 motion modes: continuous, step, distance. We can change mode by "MODE" button. The bottom of the screen can display which mode system is on.

### 1) Continuous motion mode

This mode is no special data control, in this mode, press direction key (X+ 1▲, Y+ 2▲, Z+ 3, X- 5▼, Y- 6▼, Z- 7) machine will follow, its speed is decided by current speed mode.

Notice : if user press key's time is too short (shorter than 0.5s), immediately lift buttons, machine will auto move to the nearest grid. It is always stop on grid when this motion mode is over. This motion mode is suitable for crude regulation machine coordinate situation.

### 2) Step motion mode

This mode is always run in low speed, move a grid per 0.5 second , its grid

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

distance is decided by current speed mode. This motion mode is suitable for tool adjust or precise adjust machine coordinate situation.

### 3) Distance motion mode

This mode is run by distance which user is set. When user press directory key

(

X+	Y+	Z+	X-	Y-	Z-
1▲	2△	3	5▼	6▽	7

), machine will move by set distance.

Notice: Grid can't effect to this motion. It will move by set distance, can't move to grid point.

If user want to change distance, please change to distance mode, re-enter distance value is ok.

## 5.4 Automatic machining operation

Auto processing is means system deal files in U disk and inner by command, this is also called file processing。 Before auto processing, the parameters in system and machine must be correctly set.

### Steps:

#### 1) Determine the origin of the workpiece

The origin of the coordinate of XYZ in the processing program is the origin of workpiece. Before processing, we should connect the situation to the actual . The

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

operation is as followed:

Move the machine to the situation where the file start processing. Press "" to set the origin of X Y axis, press "" to set Z axis. If used tool setting function, its no need to press "" to set origin, the key combination of tool setting is

"" + "".

## 2) Choose processing files

After determining the origin of workpiece, press "", the following dialog box appears:



Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Press “” and “” to move the cursor, press “” to choose the situation, it will displays the first three files, press “” and “” to move cursor, press “” and “” to jump 2 lines, press “” to quit.

### 3) Processing parameters setting

After choosing processing file press “” into setting processing parameters, including processing speed, travel speed, Z down ratio, speed ratio, spindle grad, pulse equivalent, and Z up distance.

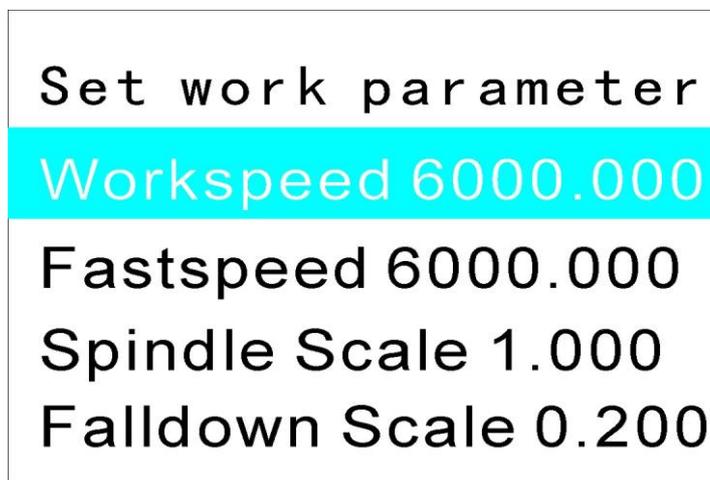

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Press “” and “” to move cursor to be modified, press “” to set, input value, press “” to save, press “” and “” to select the next. After modifying, press “” to save, system start checking files. It will start processing after checking system. Pulse equivalent there can only display can't be modified. If need to change, please back to “machine setup”. In processing, the screen will display current line, current speed, speed ratio, operating time. We can switch these option by pressing “”.

## 5.5 Processing operations

### 1) Adjust speed ratio and spindle grade

**Adjust speed ratio** In processing, press “” and “” can directly change ratio,  $\text{current speed} = \text{set speed} \times \text{ratio}$ , each click “”, ratio down drop 0.1. Speed ratio max 1.0, min 0.1, the display speed will corresponding change, but time will not change.

**Adjust spindle grade** this function can take effect when system set multi-speed.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

In processing, press “” and “” to change spindle grade 。 Each click “”, up 1 grade, S7 is the top。 Each click “”, drop 1 grade, till to S1。

## 2) Processing pause and adjust situation

 
Press “” to pause, top right corner of the screen will change “run” to “pause”, machine will stop running except spindle. Shown below:

1X	7.200	pauz
1Y	41.300	s-on
1Z	-0.200	step
Line No.	356	

In this time we can adjust situation of 3 axis, the default motion mode is step, speed is low, users can change situation, that is means machine will move a low speed grid each click; if we need quickly a large range adjust, change the speed mode to high by press “”, the motion mode change to continuous.

After that, press “”, shown :

1X	7.200	Pauz
1Y	41.300	S-ON
1Z	-0.200	Step
Restore Position ?		

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing 

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

System will let users make sure whether to save the modified

Situation, press “”, system will back to situation before modifying; press “”, system will start processing in modified situation.

### 3) Breakpoint processing and power-down protection

**Breakpoint processing** if user want to stop processing in middle , press

“”, shown below:

1X	7.200	RUN
1Y	41.300	S1
1Z	-0.200	1.0
Save break?		

System display “save break?”, if we want to save breakpoint, press “”,

LCD displays break list (total 8), press “” or “” to choose position,

and then press “” to save , system auto home. If we want to continue

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118


Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

processing from breakpoint, we can choose key combination “ +1-8” , first hold on press “” , the same time press number key (1-8) , release together, system will restore processing from point 1. Before restore process, system must have a home motion. eg: If we want to continue processing from breakpoint, we can choose key combination “”+ “” , first hold on press “” , the same time press “” , release together, system will restore processing from point 1, the same as 2-8.

#### 4) Power-down protection

when there is a sudden power failure during processing, system will save current

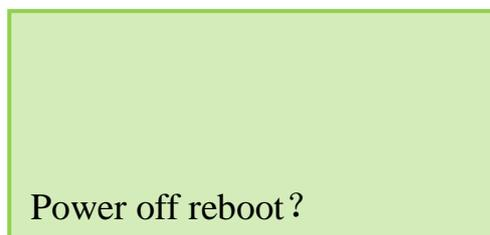

coordinate and parameters, when power restart, process continue. Before that, system must have a home motion, after home, shown as below:

Press “” to continue unfinished process, it will display the stop line, press

“” to cancel process.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## 5.6 Advanced Processing

advanced processing is a function which is satisfied for some special request. It contains: Array work, Resume work, Tool changing, Part work, calculate bound, the

key combination is “” + “” , shown below:

Advanced Work
<b>Array Work</b>
Resume Work
Tool Changing
Part Work
Calculate Bound
Mill plane

### 1) Array work

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

1. press  and  move cursor to multiple process, press  to

enter, press  and  to select different files;

2. Set process parameters, other operation is the same as general process, system start multiple processing according to users' set;

3. You can also setup in Auto Pro Setup – Work Array.

## 2) Resume work

First we should set multiple process parameters in “advanced setup”, then we can use this function. Step is as below:

1. press “” and “” move cursor to Resume work, press “” to

enter. press “” and “” to select different break points, and then

press “”, system will restore processing from the break point.

## 3) Tool changing

Achieve manually change the tools in the position you set. Press “” get

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

Into the setup, and also press “” back to work origin.

#### 4) Part work

Part work means users can select start line and end line, so part of the processing file can be processed. The step is as below:

① press “” to set, press “” and “” to move cursor to select different file list;

② press “” to enter, press “” and “” to select file, press “”, start to read the file.

③ after read the file, press “” screen displays line 1 of the code, press

“”, prompted “input start number: displays total lines”, input start line to

cursor, press  to confirm, if line number is wrong, press  to delete input number.

④ Press “” to the operation of the end line, the screen displays “input

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

end number”, Press “” he screen displays the changed start number, press “”, Input end line in cursor, press “” to confirm, press “” to modification;

⑤ Set processing parameters.

### 5) Calculate bound

Calculate area of the file.

① Press “” to set, press “” and “” to move cursor to select different file list:

② Press “” to get into file list, and then press “” and “” to choose file;

③ Press “””, start to read the file, after reading the file, the system will calculate the area.

### 6) Calculate bound

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)



Including Scan Mill and Encircle Mill

The step is as below:

### 1 Scan Mill

① Press “” 和 “” to select different type.

② Press “” to get into the milling plane parameters, including scantype、width、height、diameter、depth and Z step.

Scan Mill Set	
ScanType	X Scan
Width	100.000
Height	100.000
Diameter	10.000
Depth	0.000
Z Step	0.100

Press “” and “” to select the parameter to be setted, Press “” to select

scantype (**X Scan and Y Scan**) and the parameter, Press “” to save.

### 2 Encircle Mil

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

① Press “” and “” to select different type.

② Press “” to get into the milling plane parameters, including scantype, width, height, diameter, depth and Z step.

Encircle Mill Set	
ScanType	AC
Width	100.000
Height	100.000
Diameter	10.000
Depth	0.000
Z Step	0.100

Press “” and “” to select the parameter to be setted, Press “” to select scantype ( **clockwise and anticlockwise** ) and the parameter , Press “” to save.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beijing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## PS 1. Handle operating system upgrades

In the process of using handle, there may be some minor problems, these problems update handle software can be restored.

### U disk update

This method is update by handle operation, don't need PC. Update files is \*.PKG. Step is as below:

1、 Save update files to U disk, insert into handle.

2、 Press “”, select “system setup” press “” to enter , press “” and

“” move cursor to “**system update**”.

3、 Press “” to enter , select “**U disk files**”, select update files suffix is \*.PKG.

System will auto update.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

4、 After update, please restart the handle.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

## PS2. Operations of Handle communicating with computer

Users can copy file from computer to handle after “Product ID:A010XXXX & Update Version rz-1967” version. Connect handle and computer by USB cable, users can find portable storage device on the computer , and then copy processing files from computer to handle inner. This function can insure that if USB port of the handle is broken or there is no U disk , the machine can still work normally.

### Operation step :

1. Press any two buttons at the same time ( for example: “”+“”).
2. Connect handle and computer by USB cable , it means that the handle is powered by computer , loosen the buttons after the power supply.
3. Handle screen display :



Connect successfully.

4. Open“My Computer”, and you will find portable storage device,



Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)

A0101203(H:) :Handle, Users can copy processing files to handle inner.

5. Connect handle and machine, Choose internal file to start processing.

**NOTE:** Users can check hardware type in Version View: “FlashDiskMode” is necessary,if not, users can not copy processing files from computer to handle inner.

Add: 5th floor, No.4 building, No 4. Yard, life Rd, life science park, beiqing St., changping district Beijing, China

Tel: 010-53275118

Fax: 010-53275110/53275111

Web site: [www.richnc.com.cn](http://www.richnc.com.cn)